

Programming

Long press the "SET" button to activate the menu.

P0 Heat C/H (Set: cool mode)

P1 Hysteresis Set 0.1-15 (Set: 2°C)

P2 Upper Limit 110 (Setpoint: 110°C)


P3 Lower Limit -50 (setpoint: -50°C)

P4 Correction -7.0 ~ 7.0 (Calibration: 0)


P5 Delay Start Time 0-10 min (Delaytime: 0)

P6 High Temperature Alarm 0-110 (Set mode: OFF)

Long pressing + AND - will reset all values to their default

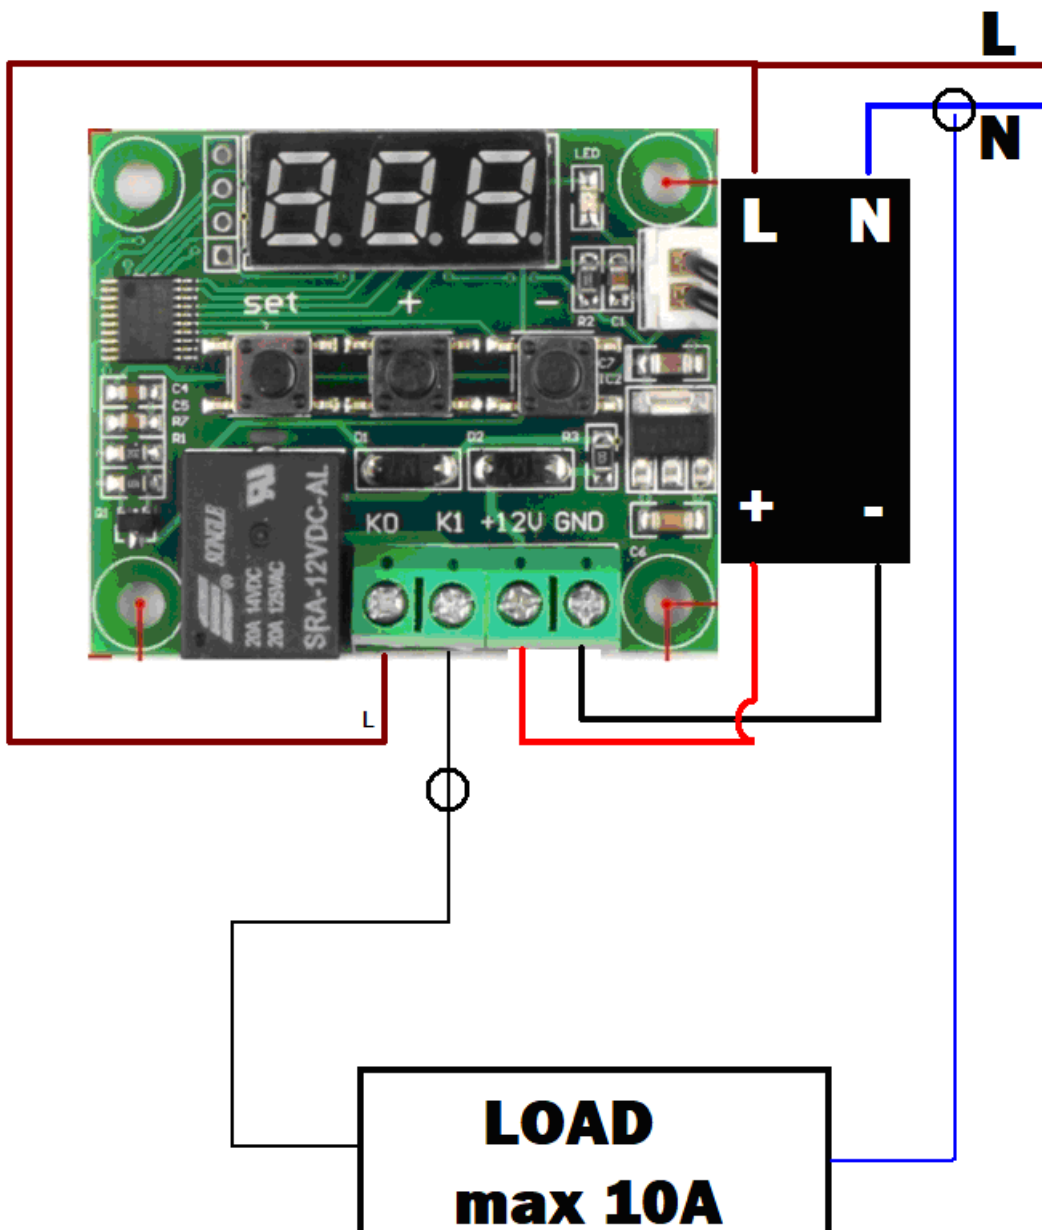


Sluit de Nul van de voeding aan op de Wago steekklem (blauwe draad). Sluit de voeding aan op klem L. Sluit de belasting aan op de zwarte draad met wago steekklem en de blauwe draad van de belasting op de Wago (blauwe draad)

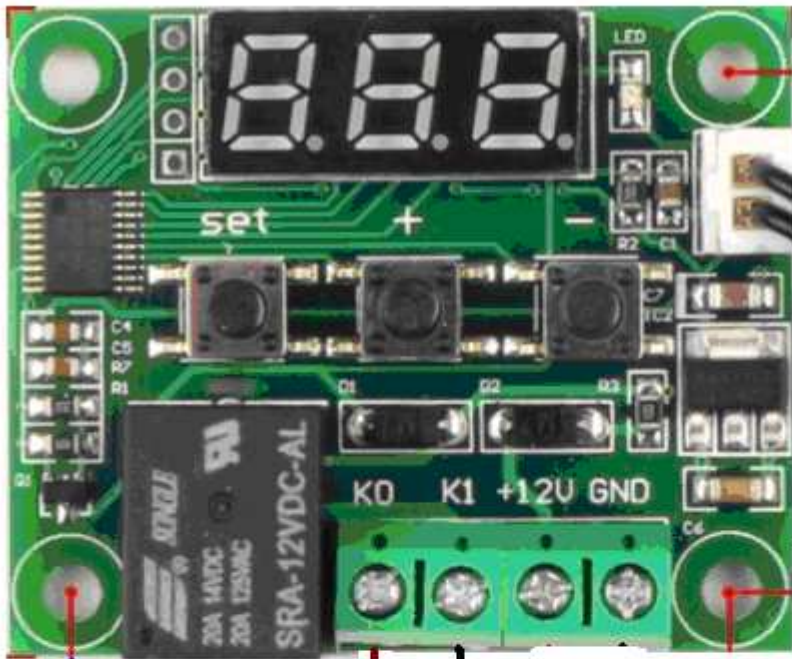

N
VOEDING
230Vac

PE

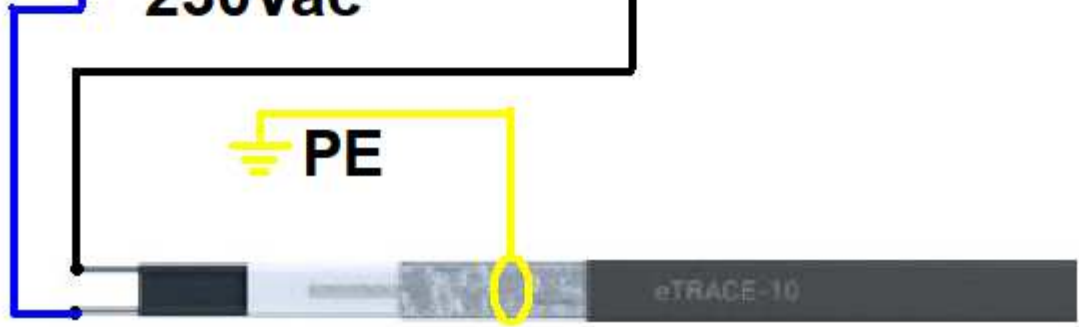

eTRACE-10